




Smoke and Dye-Water Observation Summary

Western Run Pilot Project - Baltimore Maryland

FIELD SKETCH

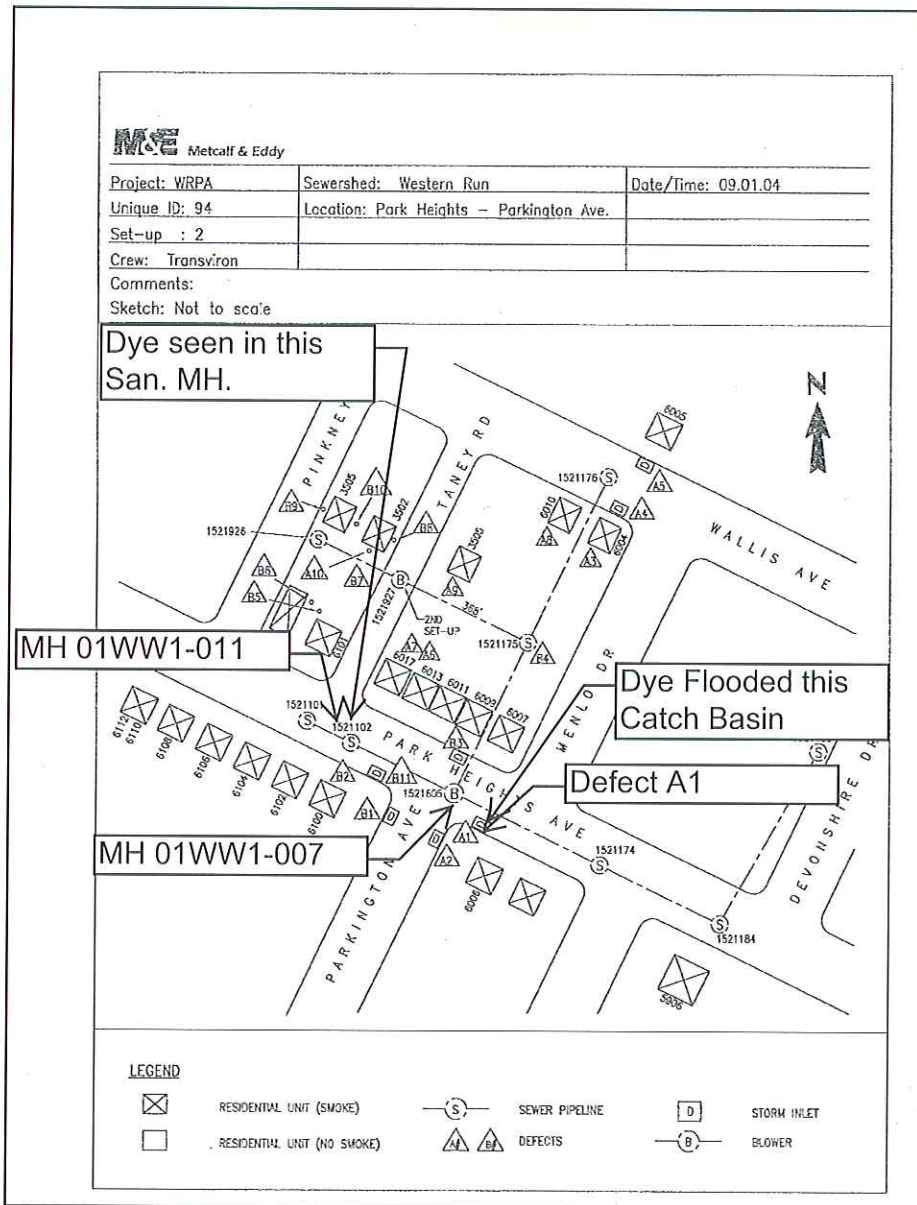

Sketch No: 94

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke Testing\Pictures\Sketches\94.tif

Image Status: Image found and displayed.

NOTE: Sanitary sewer alignments and connectivity in the Western Run GIS have been revised following smoke testing to reflect updated information from various sources and may no longer match the field sketches shown.

DYE TESTING FORM

Sketch (NTS)

Dye Test 94

* THIS CB, Show North Arrow
WOULD BE TEST B3

PARK HEIGHTS AVE

NO PLACE TO PLUG.

(IN LINE
CONN.)

NO PLACE TO
PLUG
IN LINE.

CONN →
TEST # ?

Dye seen in this
San. MH in the
Drop Conn.

PLUG

152/605

MH 01WW1-007

Defect A1

Dye Flooded this Catch
Basin


MH 01WW1-011

PARKINGTON
AVE

RESIDUAL CODES	SOURCE - WHERE CODES			
1. POSITIVE	1. MAIN SEWER	5. DOWN SPOUT	9. STAIRWELL DRAI	13. STORM DRAIN
2. NEGATIVE	2. SERVICE LINE	6. DWNSTPT CONN.	10. FOUNDATION DRAIN	14. CATCH BASIN
3. CANNOT TEST	3. TRANSITION JOIN	7. AREA DRAIN	11. BUILDING INTERIOR	15. STORM MH
	4. CLEAN OUT	8. DRIVEWAY DRAIN	12. MH FRAME/SEAL	16. STORM DITCH
Additional Comments: DYE LEAKS THROUGH JOINTS OF THE DROP CONN. NOT THE LINE ITSELF. FROM SAN M.H. 1521102				

10/2/02

4/11/02



INSPECTION IMAGES

CITY: BALTIMORE	STREET: PARKHIGHTS AVE. 94 A 1	DATE: 04/04/2005	SECTION NR: 25	SECTION NAME:
--------------------	-----------------------------------	---------------------	-------------------	---------------



IMAGE: 15a, TAPE #: JAM 2, 00:07:27
2FT, DROP FROM LINE OF 1521102



IMAGE: 16a, TAPE #: JAM 2, 00:10:07
3.92FT, Infiltration Running at joint at 07 o'clock, DOWN THE DROP



IMAGE: 17a, TAPE #: JAM 2, 00:11:24
15.8FT, inspection ends